



Texas Oil Tools

2800 N. Frazier (77303)
PO Box 2327
(409)756-4800 or (713)350-4799
(409)756-8102 Fax

Product Service Bulletin

PRODUCT

All 2.50" Tandem Side-Door Stripper/Packers
Reference Tech Units 1170, 1207, 1223 and 1233.


FAULT

It has come to Texas Oil Tool's attention that there is a fault with 2.50" Tandem Side-Door Stripper/Packers; namely that the main 'M' seal in the bottom sub can extrude at higher pressures. This condition only occurs when the piston is being pressurised to retract, but with the doors closed, eg, when pressure testing the upper stripper.


REMEDY

The remedy for this potential occurrence is to change out the existing step ring (part number 9101-2926) with a new, longer ring (part number 9628-2120), see sketch below for details of change.

All users of these stripper/packers should contact their nearest Drexel location to obtain the new step ring. The serial number of the specific stripper/packer must be quoted when ordering the new step ring.

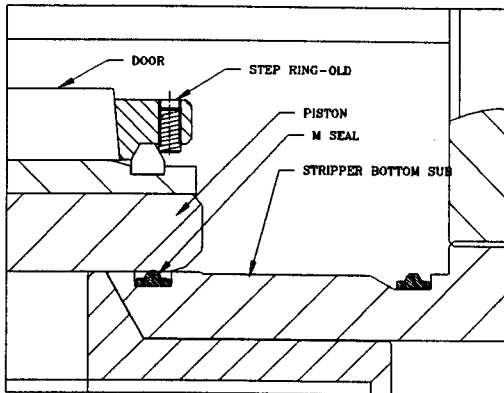

EXISTING ARRANGEMENT

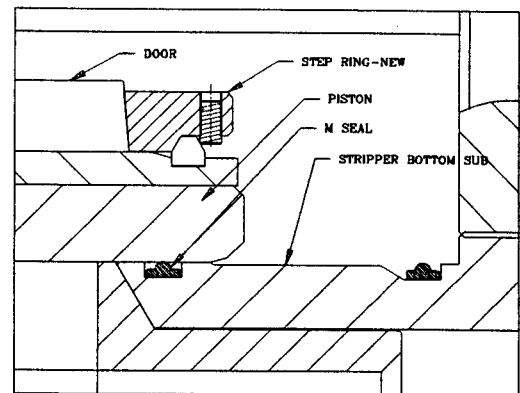

NEW ARRANGEMENT

Approved
WLB
Willie Burnett

All 2.50" Tandem Side-Door Stripper/Packers

PSB-035

September 1996